

Burlington

 777 Chrysler Drive
 Burlington, WA 98233
 Phone: (360) 755-1990

Client:

 Menzel Lake Gravel
 PO Box 1494
 Marysville, WA 98270

Project:

 24B108
 Q.C. - Menzel Lake Gravel - 2024
 777 Chrysler Drive
 Burlington, WA 98233

General Information

Sample Number:	81	Sample Date:	05/30/2024
Sample From:	Not Given	Sampling Method:	Not Provided
Location Details:	Menzel Lake Gravel Pit / Washed 1.5" minus drain rock material		
Material Description:	Not Given	Technician:	Client

Test Results
Specification: No Specifications **Variant:** Grad Only Sieves

Sieve Size	Percent Passing	Percent Retained	Cumulative Fraction Retained	Result
50 mm (2 inch)	100	0		Pass
37.5 mm (1.5 inch)	100	0		Pass
25 mm (1 inch)	30	70		Pass
19 mm (3/4 inch)	4	96	0.96	Pass
12.5 mm (1/2 inch)	2	98		Pass
9.5 mm (3/8 inch)	1	99	0.99	Pass
6.3 mm (1/4 inch)	1	99		Pass
4.75 mm (No. 4)	1	99	0.99	Pass
2.36 mm (No. 8)	1	99	0.99	Pass
2 mm (No. 10)	1	99		Pass
1.18 mm (No. 16)	1	99	0.99	Pass
600 µm (No. 30)	1	99	0.99	Pass

Fineness Modulus: 0.06

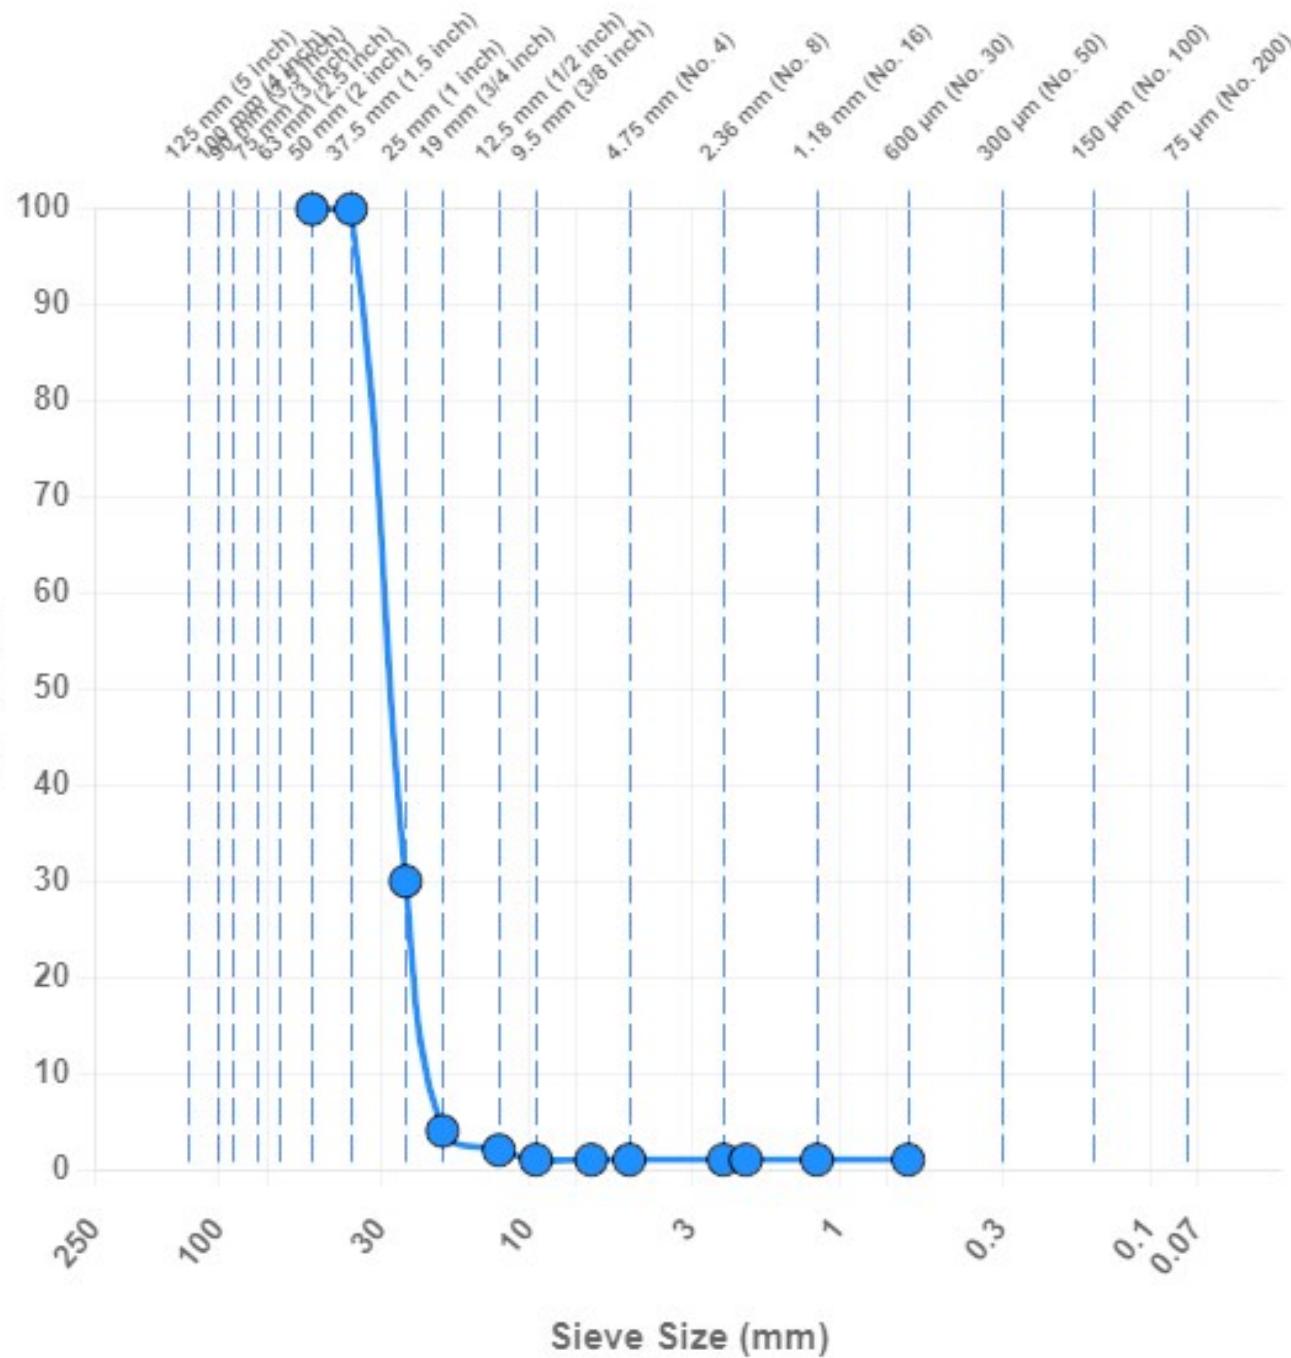
Burlington

 777 Chrysler Drive
 Burlington, WA 98233
 Phone: (360) 755-1990

Client:

 Menzel Lake Gravel
 PO Box 1494
 Marysville, WA 98270

Project:

 24B108
 Q.C. - Menzel Lake Gravel - 2024
 777 Chrysler Drive
 Burlington, WA 98233


Test Date: 06/04/2024

Lab Technician: Zach Romney